NUMBER BROOKHAVEN NATIONAL LABORATORY IH96400 Safety & Health Services Division INDUSTRIAL HYGIENE GROUP REVISION Final Rev5 Standard Operating Procedure: Field Procedure INSTRUMENT OPERATION: SUBJECT: DATE 11/02/05 GenRad 1982 PAGE As a Precision Sound-Level Meter **1** OF 15

Contents

- 1.0 Purpose/Scope
- 2.0 Responsibilities
- 3.0 Definitions
- 4.0 Prerequisites
- 5.0 Precautions
- 6.0 Procedure
- 7.0 Implementation and Training
- 8.0 References
- 9.0 Attachments
- 10.0 Documentation

1.0 Purpose/Scope

This procedure provides a standardized method for the operation of the GenRad GR1982 Precision Sound Level Meter. It should be used in conjunction with the SBMS Subject Area *Noise and Hearing Conservation* and IH SOP IH96200 *Noise Measurement Principles: Area Surveys*.

The GenRad 1982 provides a method for easy and accurate surveys of workplace noise exposures. This area survey meter should be used to determine the baseline noise levels and area noise levels. Its use is designed for conducting noise surveys to determine the need for area warning posting, locate problem-noise sources, and measuring the effectiveness of engineering controls.

The GenRad 1982 can be used as a screening tool to determine the need for personal monitoring and to sketch isometric lines for control area delineation. Generally, employee exposure assessments should be made with a noise dosimeter. However this area survey meter can be used in limited situations for exposure assessments, such as for operations that are of short duration and involve limited employee movement. This allows the meter to measure the actual employee exposure. In these cases, the meter reading must be observed over the entire time of exposure.



BROOKHAVEN NATIONAL LABORATORY Safety & Health Services Division		IH96400
	INDUSTRIAL HYGIENE GROUP Standard Operating Procedure: Field Procedure	REVISION Final Rev5
SUBJECT:	INSTRUMENT OPERATION: GenRad 1982	DATE 11/02/05
	As a Precision Sound-Level Meter	PAGE 2 OF 15

2.0 Responsibilities

- 2.1 Use of the GenRad 1982 is limited to persons who act under the direction of a competent hazard assessment person and have demonstrated the competency to satisfactorily use the meter as evidenced by experience and training to the qualification criteria set by BNL.
- 2.2 Personnel that perform exposure monitoring with this instrument are responsible to follow all steps in this procedure.
- 2.3 The data collected using this meter must have an appropriate evaluation of the hazard and risk by a skilled Industrial Hygiene professional.

3.0 **Definitions**

- 3.1 *Decibel (dB):* A non-dimensional unit used to express sound pressure levels. It is the log of the ratio of the measured sound pressure level to a reference level. *dBA:* A sound pressure level in decibels made on the A-scale of a sound level meter. This unit of measure approximates the response of the human ear. *dBC:* Sound pressure based on a nearly flat, non-weighted scale.
- 3.2 *Frequency:* The number of cycles completed by a periodic quantity in a unit time. Unit, hertz (Hz) measures cycles per second.
- 3.3 *Impulse or Impact Noise Levels:* Variations in noise levels that involve peak levels spaced at periods of greater than one per second. Where the intervals are less than one second, it should be considered a continuous noise source.
- 3.4 Occupational Exposure Limit: The maximum time weighted average (TWA) exposure permitted for employee exposure, based on the less of the OSHA Permissible Exposure Limits (PEL) or ACGIH Threshold Limit Value (TLV). See IH96200.

4.0 Prerequisites

4.1 Training prior to using this meter:

- 4.1.1 Demonstration of proper operation of the instrument to the satisfaction of the employee's supervision. Refer to Section 7 *Implementation and Training*.
- 4.1.2 Other appropriate training for other hazards in the area to be entered may be needed. Check with ESH coordinator or FS Representative for the facility.

	BROOKHAVEN NATIONAL LABORATORY Safety & Health Services Division	IH96400
	INDUSTRIAL HYGIENE GROUP Standard Operating Procedure: Field Procedure	REVISION Final Rev5
SUBJECT:	INSTRUMENT OPERATION: GenRad 1982	11/02/05 PAGE
	As a Precision Sound-Level Meter	3 OF 15

4.2 Area Access:

- 4.2.1 Contact the appropriate Facility Support Representative or Technician to obtain approval to enter radiological areas.
- 4.2.2 Verify with the appropriate Facility Support Representative or Technician if a Work Permit or Radiological Work Permit is needed or is in effect. If so, review and sign the permit.
- 4.2.3 Use appropriate PPE for area

5.0 Precautions

5.1 Hazard Determination:

- 5.1.1 The operation of this meter does not cause exposure to any chemical, physical, or radiological hazards. The meter design does not cause significant ergonomic concerns in routine use. The meter does not generate Hazardous Waste.
- 5.1.2 By its very nature, the GenRad meter may be used in areas where excessive noise levels exist or are suspected to be present. Exposures to noise levels above the PEL and/or TLV may cause temporary or permanent hearing loss.

5.2 Personal Protective Equipment:

- 5.2.1 In areas where noise levels exceed the *Occupational Exposure Limit (OEL)*, hearing protection should be worn. The hearing protection should be able to reduce the noise levels below the OEL. See IH96200 for guidance on PPE selection.
- 5.2.2 Additional PPE: Other appropriate PPE for the area being entered. Check with your FS Representative.

6.0 Procedure

Equipment: (Pictured in Appendix 9.1)

- Meter Body
- Microphone

NUMBER BROOKHAVEN NATIONAL LABORATORY IH96400 Safety & Health Services Division INDUSTRIAL HYGIENE GROUP REVISION Final Rev5 Standard Operating Procedure: Field Procedure INSTRUMENT OPERATION: SUBJECT: DATE 11/02/05 GenRad 1982 PAGE As a Precision Sound-Level Meter **4** OF 15

- Battery Pack
- Battery Charger
- Wrist Strap
- Calibration screwdriver
- Sub-miniature phone plug
- 10-foot microphone extension cable
- Calibrator

Operation of the GenRad (picture of meter and description of controls and displays is contained in Appendix 9.1.)

6.1 Battery Check

- 6.1.1 Slide the Power switch to the **BAT** and hold it there briefly.
- 6.1.3 Perform the battery check at least once every half hour of use.
- 6.2 **Warm-up:** A warm-up is not required for this meter.

6.3 Calibration:

- 6.3.1 Verify that the calibrator battery checks ok.
- 6.3.2 Slide the *Power Switch* to **ON** and the *DIGITAL DISPLAY* switch to **CONT**.
- 6.3.3 Set the *Octave Filter* switch to **WTG**, the *WEIGHTING* switch to **A**, and the *Detector* switch to **Slow**. Select the **70** to **120** dB range.
- 6.3.4 Turn the calibrator on and select 1000 Hz (1kHz).
- 6.3.5 Place the calibrator, with ½ inch coupler/adaptor installed, over the microphone of the sound level meter (SLM).
- 6.3.6 Observe that both the SLM pointer and the digital display indicate 114 (plus or minus 0.5 dB). If the indication is outside this range, adjust the **CAL** control.

6.4 **Operation:**

- 6.4.1 Select the desired weighting by sliding the *WEIGHTING* switch to **A**, **B**, **C** or **FLAT**. The *OCTAVE FILTER* switch must be in the **WTG** position.
- 5.4.2 Select desired detector characteristic by sliding the *DETECTOR* switch to *FAST*, *IMP*, *PEAK*, or *SLOW*. The detector can be reset in either the *IMP* or *PEAK* modes by depressing the *CAPTURE* button momentarily.
- 6.4.3 Adjust the dB RANGE switch for an on-scale meter indication and read the

	BROOKHAVEN NATIONAL LABORATORY Safety & Health Services Division	IH96400
	INDUSTRIAL HYGIENE GROUP Standard Operating Procedure: Field Procedure	REVISION Final Rev5
SUBJECT:	INSTRUMENT OPERATION: GenRad 1982	DATE 11/02/05
	As a Precision Sound-Level Meter	PAGE 5 OF 15

meter or digital display. If the OVERLOAD lamp is lit, adjust the *dB RANGE* switch to a higher range.


6.5 **Digital Display:**

- 6.5.1 For a display that duplicates the meter indication, set the *DIGITAL DISPLAY* switch to *CONT*. The display will now track the meter indication.
- 6.5.2 To capture a measurement, slide the *DIGITAL DISPLAY* switch to *CONT* and at the desired moment, press and hold the *CAPTURE* button. The digital display will be "frozen" as long as the *CAPTURE* button is held.
- 6.5.3 To capture the maximum indication during a measurement period, slide the *DIGITAL DISPLAY* switch to *MAX*. Press the *CAPTURE* button and release it to begin the measurement period.
- 6.6 **Operator Position:** Preferably the operator should be further from the sound source than the microphone and positioned as to reduce reflection of the sound to the meter. Hold the meter at arms length.
 - DO NOT stand between the sound source and microphone.
 - DO NOT place the hand within 12 cm (5 inches) of the microphone.
 - The microphone is a "flat-random-incidence-response type".

 <u>Do not point the meter at the source, hold it at a 70-90 degree angle</u>, i.e., take the measurement so that the path from the noise source to the microphone is along a 70⁰ to 90⁰.)
 - Take measurements at ear level of employee (sitting, standing or bending) to estimate personal exposures and to locate isometric lines of noise intensity on a sketch for defining area levels.

6.7 **Recording readings:**

- 6.7.1 Use the BNL Area Survey Form (Attachment 9.4) to record readings (see the IH web page for the most recent version).
- 6.7.2 Return meter and original sampling form to the SHSD IH Laboratory daily or at the end of each project as agreed to by the IH Laboratory Technician.
- 6.7.3 Send a copy of any hazard evaluation report written on the survey to the IH Laboratory and the Occupational Medicine Clinic.

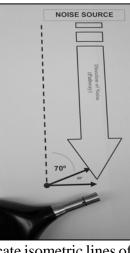

BROOKHAVEN NATIONAL LABORATORY Safety & Health Services Division		IH96400
	REVISION Final Rev5	
SUBJECT:	INSTRUMENT OPERATION: GenRad 1982	DATE 11/02/05
	As a Precision Sound-Level Meter	PAGE 6 OF 15

6.7.4 Post-calibrate (i.e. single point operational accuracy check) the meter as per the Instrument Operation SOP.

7.0 Implementation and Training

- 7.1 Training prior to using this meter includes a demonstration of proper operation of the instrument based on training, education, and experience. All persons must have met the qualification criteria for IH96 Noise Assessor set in IH50300 BNL IH Program and IH Group Training & Qualification Matrix.
- 7.2 Personnel are to document their training using the Attachment 9.5, the Job Performance Measure Completion Certificate for this meter. Qualification on this JPM is required on a 3 year basis, providing the professional is monitoring noise sources frequently.
- 7.3 A baseline audiogram may be needed if the duration of exposure to the person performing the survey will be in excess of the OSHA Permissible Exposure Limits (PEL) or ACGIH Threshold Limit Value (TLV) (which ever is less). See IH96200.
- 7.4 Other appropriate training for the area to be entered (check with ESH coordinator or FS Representative for the facility).

8.0 References

- 8.1 GenRad GR 1982 Precision Sound-Level Meter and Analyzer Instruction Manual.
- 8.2 BNL SBMS Subject Area Noise and Hearing Conservation.
- 8.3 OSHA Noise/Hearing Conservation 29CFR1910.95.
- 8.4 NIOSH Criteria for a Recommended Standard-Occupational Noise Exposure, 1998.
- 8.5 ACGIH American Conference of Governmental Industrial Hygienists Threshold Limit Values for Chemical Substances and Physical Agents and Biological Exposure Indices.

9.0 Attachments

	BROOKHAVEN NATIONAL LABORATORY Safety & Health Services Division	IH96400
	REVISION Final Rev5	
SUBJECT:	INSTRUMENT OPERATION: GenRad 1982	DATE 11/02/05
	As a Precision Sound-Level Meter	PAGE 7 OF 15

- 9.1 Photo of meter and parts
- 9.2 Theory of Operation
- 9.3 Short List of Operating Instructions
- 9.4 Area Survey Form
- 9.5 Job Performance Measure Completion Certificate

10.0 **Documentation**


Document Development and Revision Control Tracking				
PREPARED BY: (Signature and date on file) C. Kramer	REVIEWED BY: (Signature and date on file) J. Peters	APPROVED BY: (Signature and date on file) R. Selvey		
Author	SHSD IH Group	SHSD IH Group Leader		
Date 02/16/01	Date 02/20/01	Date 02/22/01		
ESH Coordinator/ Date:	Work Coordinator/ Date:	SHSD Manager / Date		
none	none	none		
QA Representative / Date:	Training Coordinator / Date:	Filing Code:		
none	none	IH52		
Facility Support Rep. / Date:	Environ. Compliance Rep. / Date:	Effective Date:		
none	none	02/23/01		
ISM Review - Hazard Categorization ☐ High ☑ Moderate ☐ Low/Skill of the craft	Validation: ☐ Formal Walkthrough ☐ Desk Top Review ☐ SME Review Name / Date:	Implementation: Training Completed: Tracked in BTMS Procedure posted on Web: 11/02/05 Hard Copy files updated: 11/02/05		

Revision Log			
Purpose: Temporary Change Chang	ge in Scope 🗌 Periodic review 🛚 Clarify/en	hance procedural controls	
Changed resulting from: ☐ Environmental impacts ☐ Federal, State and/or Local requirements ☐ Corrective/preventive actions to non-conformances ☒ none of the above			
Section/page and Description of change: Renumbered from IH-FP-107 to new system IH96400. Added SURVEY FORM and made minor format changes.			
(signature on file) R. Selvey 03/09/01 SME Reviewer/Date: Reviewer/Date: Reviewer/Date:			

NUMBER **BROOKHAVEN NATIONAL LABORATORY** IH96400 Safety & Health Services Division **INDUSTRIAL HYGIENE GROUP** REVISION Standard Operating Procedure: Field Procedure Final Rev5 INSTRUMENT OPERATION: SUBJECT: DATE 11/02/05 GenRad 1982 PAGE As a Precision Sound-Level Meter **8** OF 15

Purpose: ☐ Temporary Change ☐ Change in Scope ☐ Periodic review ☐ Clarify/enhance procedural controls				
Changed resulting from: ☐ Environmental impacts ☐ Federal, State and/or Local requirements ☐ Corrective/preventive actions to non-conformances ☒ none of the above				
Section/page and Description of change: R	evised to include RCD Facility Support Proce	edure Committee Review comments.		
(signature on file) R. Selvey 04/20/01 SME Reviewer/Date:	Reviewer/Date:	Reviewer/Date:		
Purpose: Temporary Change Chang	ge in Scope ☐ Periodic review ☒ Clarify/e	nhance procedural controls		
Changed resulting from: ☐ Environmental to non-conformances ☒ none of the above	impacts	uirements Corrective/preventive actions		
	orrected calibration clerical error in step 6.2.	1.3.6 from 5 dB to 0.5 dB.		
(signature on file) R. Selvey 04/27/01 SME Reviewer/Date:	Reviewer/Date:	Reviewer/Date:		
Purpose: Temporary Change Chang	ge in Scope Periodic review Clarify/e	nhance procedural controls		
Changed resulting from: ☐ Environmental to non-conformances ☐ none of the above	impacts	uirements Corrective/preventive actions		
	arified wording on pre and post calibration to	reinforce policy in IH51660.		
(signature on file) R. Selvey 06/08/01 SME Reviewer/Date:	Reviewer/Date:	Reviewer/Date:		
Purpose: Temporary Change Chang	ge in Scope 🛛 Periodic review 🔲 Clarify/e	nhance procedural controls		
Changed resulting from: ☐ Environmental to non-conformances ☐ none of the above	impacts	uirements Corrective/preventive actions		
SBMS. Updated reference to JPM in IH961	evised format with Section 7 as Implementat 120.	ion and Training. Updated references to		
(signature on file) R. Selvey 04/12/04 SME Reviewer/Date:	(signature on file) R. Selvey 04/12/04 SME Reviewer/Date: Reviewer/Date: Reviewer/Date:			
Purpose: Temporary Change Chang	ge in Scope 🗌 Periodic review 🛚 Clarify/e	nhance procedural controls		
Changed resulting from: ☐ Environmental impacts ☐ Federal, State and/or Local requirements ☐ Corrective/preventive actions to non-conformances ☒ none of the above				
Section/page and Description of change: Added Attachment 9.5. Change in Section 7.				
(signature on file) R. Selvey 07/12/04 SME Reviewer/Date:	Reviewer/Date:	Reviewer/Date:		
Purpose: ☐ Temporary Change ☐ Change in Scope ☐ Periodic review ☐ Clarify/enhance procedural controls				
Changed resulting from: ☐ Environmental impacts ☐ Federal, State and/or Local requirements ☐ Corrective/preventive actions to non-conformances ☐ none of the above				
Section/page and Description of change: R	Revised Section 7 training requirements. Upo	dated Section 10 to new format.		
(signature on file) R. Selvey 11/02/05 SME Reviewer/Date: Reviewer/Date: Reviewer/Date:				

	BROOKHAVEN NATIONAL LABORATORY Safety & Health Services Division	IH96400
	INDUSTRIAL HYGIENE GROUP Standard Operating Procedure: Field Procedure	REVISION Final Rev5
SUBJECT:	INSTRUMENT OPERATION: GenRad 1982 As a Precision Sound-Level Meter	11/02/05 PAGE 9 OF 15

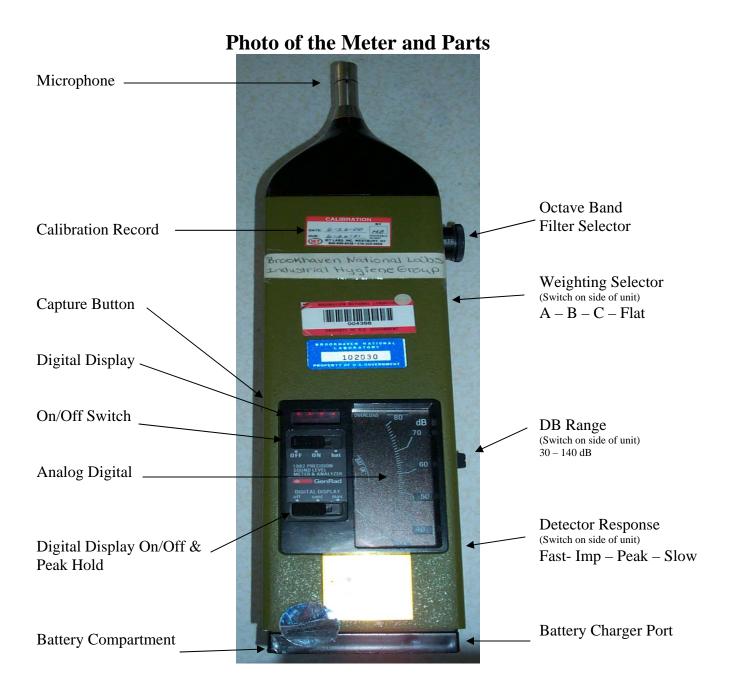

	BROOKHAVEN NATIONAL LABORATORY Safety & Health Services Division	IH96400
	REVISION Final Rev5	
SUBJECT:	INSTRUMENT OPERATION: GenRad 1982	DATE 11/02/05
	As a Precision Sound-Level Meter	PAGE 10 OF 15

Attachment 9.2

Theory of Operation

The GenRad GR 1982 is a precision sound level meter which incorporates octave-band filters from 31.5 Hz to 16 kHz, A, B, C and Flat weighting networks, as well as FAST, SLOW, IMPACT and IMPULSE detector response. The sound pressure is displayed on a 50-dB linear scale. The meter utilizes a 4-digit display that follows the analog meter indication with a 0.1 dB resolution.

- A reading can be captured on the digital display at the precise instant required while the analog meter continues to track the incoming noise level
- The digital display can be used in the continuous mode or it can be operated to capture and hold the maximum level encountered. This is extremely useful when measuring sounds of short duration or vehicle "passerby" sounds.
- In the maximum mode, the digital display will be updated by the highest sound level. The display can be reset by pressing a button.
- In the peak (impact) or impulse modes, the peak detector can be reset by the press of a button. This allows other readings to be taken without waiting for the peak detector to decay.

Weighting Networks. The meter contains three weighting networks, A, B, C, which shape the noise to discriminate against the frequency components of the measured noise.

- A Network: Simulates subjective responses to noise. Generally used in noise surveys to locate noise hazards. The A Network discriminates the low frequencies quite severely Most regulations require that noise be measured on the A-weighting scale.
- B Network: Moderately discriminates (filters) against low frequencies
- *C Network*: Barely discriminates (filters) against low frequencies.

If measured sound levels of noise are much higher on the C-weighting than on the A- weighting, much of the noise is contributed by the low frequencies.

BROOKHAVEN NATIONAL LABORATORY Safety & Health Services Division		IH96400
	REVISION Final Rev5	
SUBJECT:	INSTRUMENT OPERATION: GenRad 1982	DATE 11/02/05
	As a Precision Sound-Level Meter	PAGE 11 OF 15

Attachment 9.3

Short Operating Instructions

	Step	User Action	Digital Display
1	Battery Check	Slide power switch to battery – hold briefly.	&&&. &
	-	Pointer should indicate BAT ok	
2	Calibration	Power switch <i>ON</i>	CONT
		Octave Filter switch – <i>WTG</i>	
		Weighting Switch to A	
		Detector Switch to <i>SLOW</i>	Select 70-120 dB
		Turn Calibrator on and place over microphone of	range: meter reading
		meter (using installed ½ inch coupler/adaptor), set	of II4 (plus or minus
		meter at 1 kHz	5 dB) is acceptable.
3	Operation	Slide Weighting Switch to A, B, C or FLAT	
		Slide Detector Switch to FAST, IMP, PEAK or	
		Slow	
		Adjust <i>dB range</i>	
4	Capturing	Slide Digital Display Switch to <i>CONT</i> and press	
	Measurement	CAPTURE button.	
		To capture maximum dB level during	
		measurement, slide Digital Display Switch to	
		MAX and Press CAPTURE button.	
5	Operator	Stand at the same distance from sound source as	
	Position	the microphone. Hold Meter at arms length.	

	BROOKHAVEN NATIONAL LABORATORY Safety & Health Services Division	IH96400
	INDUSTRIAL HYGIENE GROUP Standard Operating Procedure: Field Procedure	REVISION Final Rev5
SUBJECT:	INSTRUMENT OPERATION: GenRad 1982	DATE 11/02/05
	As a Precision Sound-Level Meter	PAGE 12 OF 15

Attachment 9.4
Sound Pressure Level Meter
Area Survey Form
(form is two sided)
(next 2 pages)

Attachment 9.5 Job Performance Measure

(one page) (follows Attachment 9.4)

	NATIONAL LABORATORY sfety Health and Qualification Directorate							SOL	JND PF				URVEY T FORM					
DATE:		SURVE	EYOR(S)):														
I. AREA INFO	RMATION	DI DO:						DOOM										
DEPT:		BLDG:						ROOM	-									
SOURCE:																		
ENGINEERIN	G CONTROLS:																	
II. EMPLOYEE	E INFORMATION																	
FIRST NAME:	:	LAST	NAME:					BNL #:										
DEPT:		BLDG:						JOB TI	TLE:									
EXPOSURE DURATION (HRS):			SURE (T	IMES PE	R DAY):		EXPOS	SURE (D	AYS PEI	R YR):							
JOB PERFOR	RMED:																	
PPE USED:																		
	NSTRUMENT INFORMATION	MODE						CEDIA	ı <i>4</i> .									
INSTRUMENT					.,			SERIAL#: POST CAL: BY:										
	ALIBRATION DATE:	PRE-C			Y:			POST										
BATTERY CH		15.4	125	250	500	1000	2000	ID A	125	250	500	1000	2000					
CALIBRATOR	(SERIAL #:	dBA						dBA										
		dBC						dBC										
IV. SAMPLING	G INFORMATION & RESULTS																	
Response: _	FASTSLOW		WINE	SCREE	N: Y	N												
	LOCATIO	ON OF				SPL RE	ADING	COMMENTS, SPECIAL CONDITIONS,										
TIME	SAMPLE R	EADING				dBA	dBC	and/or STATUS OF SOUR					RCE					
Addition	nal Data on back of form																	
W 001101110																		
V. CONCLUS	IONS & RECOMMENDATIONS																	
D. I	ted form to CUDD III.						EU E 00	DE 11:0-	00	F051:"	100.1	- 0	(00/0::)					
Return comple	eted form to: SHSD IH Lab						FILE CO	טב: IH96	SK.	FORM IF	196 Are	a Survey	/ (03/01)					

IV. SAMPLING INFORMATION & RESULTS (continued)													
Response:FA	ASTSLOW	WIND SCREEN											
		LOCATION OF		SPL RE	COMMENTS, SPECIAL CONDITIONS,								
TIME		SAMPLE READING		dBA	dBC	and/or STATUS OF SOURCE							

SKE	ТСН	OF	SA	MPI	LIN	G A	RE/	A (C	OPT	1ON	IAL))																							
											. ′																								
	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•			
	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•			
	•	•		•	•	•	•	•	•	•		•	•	٠	•	•	٠	•	•	•	•	•	•	•		•	•	•	•	•	•	•			
	•	•		•	٠	•	•	٠	•	•		٠	٠	•	•	٠	•		•	•	•		٠	•		•	•	٠	•	٠		•			
	•	•		•	•	•						•		•	•		•			•	•					•			•			•			
																																•			
	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•			
	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•			
	•	٠		•	•	•	•	٠	•	•		•	•	٠	•	•	٠	•	•	•	•	•	•	•		•	•	•	•	•	•	•			
	•	•		•	٠	•	•	٠	•	•		٠	٠	•	•	٠	•		•	•	•	•	٠	•		•	•	٠	•	٠		•			
			٠	•		•	٠	٠	•	•			٠			٠			•			•	•	•			•	•				•			
	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•			
	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•			
	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•			
	•	•	•	•	•	•	•	٠	•	•	٠	•	٠	•	•	٠	•	•	•	•	•	•	•	•	•	•	•	٠	•	•	•	•			
	•	•	٠	•	٠	•		٠	٠	٠		•	٠	•	•	٠	•	•		•	•		•			•		٠	•			•			
	•	•		•	•	•						•		•	•		•			•	•					•			•			•			
	-	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	-	-	-	•	-	-	-	-	•	-	-	-	-			
	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•			
	•	•	•	•	•	•	•	٠	•	•	•	•	•	•	•	٠	•	•	•	•	•	•	•	•	•	•	•	٠	•	•	•	•			

HP-IHP-96400

Industrial Hygiene Program IH 96400 Attachment 9.5

Noise and Hearing Conservation Operation of the GenRad 1982 as SPL Meter



Candidate's Name		Life Nu	umber:	
Practical Skill Evalua	ntion: Demonstration of Evaluation Methodology		ral Ex	am
Criteria	Qualifying Performance Standard	Unsat.	Recov.	Satis
1. Hazard Analysis	Understands the need to perform a hazard analysis of the area and potential exposure to the self as sampler and workers in the area.			
2. Personal Protective Equipment	Understands the need to be aware of the potential surface contamination, airborne levels of contaminants, radiological hazards, and noise hazard. Knows how to determine the need for PPE.			
3. Sampling Equipment	Knows where equipment needed for the procedure is located and how to properly sign it out.			
6. Operating Parameters	Knows the theory to establish operating parameters (safety envelope) for the equipment.			
7. Documentation	Demonstrates correctly filling out IH monitoring forms.			
Criteria	ation - Practical Skill Evaluation: Demonstration Qualifying Performance Standard	Unsat.	Recov.	Sati
Citteila	duality ing i criorinario otariaara	1		
1. Turning the Meter On	Demonstrates correctly activating the meter and turning it off			
Turning the Meter On and Off Calibration of the Meter	Demonstrates correctly activating the meter and turning it off Demonstrates correctly calibrating/bump checking the meter			
and Off 2. Calibration of the Meter 3. Clearing Stored data				
and Off 2. Calibration of the Meter 3. Clearing Stored data 4. Operation of taking a	Demonstrates correctly calibrating/bump checking the meter			
and Off 2. Calibration of the Meter 3. Clearing Stored data 4. Operation of taking a reading 5. Downloading stored data	Demonstrates correctly calibrating/bump checking the meter Demonstrates the correctly to erase stored data			
and Off 2. Calibration of the Meter 3. Clearing Stored data 4. Operation of taking a reading 5. Downloading stored	Demonstrates correctly calibrating/bump checking the meter Demonstrates the correctly to erase stored data Demonstrates correctly hold the meter, and the correct settings Demonstrates correctly extracting stored data from the meter to			
and Off 2. Calibration of the Meter 3. Clearing Stored data 4. Operation of taking a reading 5. Downloading stored data 6. Clearing data after downloading	Demonstrates correctly calibrating/bump checking the meter Demonstrates the correctly to erase stored data Demonstrates correctly hold the meter, and the correct settings Demonstrates correctly extracting stored data from the meter to paper printout and electronic storage.	corres	spondin	g S
and Off 2. Calibration of the Meter 3. Clearing Stored data 4. Operation of taking a reading 5. Downloading stored data 6. Clearing data after downloading	Demonstrates correctly calibrating/bump checking the meter Demonstrates the correctly to erase stored data Demonstrates correctly hold the meter, and the correct settings Demonstrates correctly extracting stored data from the meter to paper printout and electronic storage. Demonstrates correctly for removing stored data for the next user.	e corres	spondin	g S
and Off 2. Calibration of the Meter 3. Clearing Stored data 4. Operation of taking a reading 5. Downloading stored data 6. Clearing data after downloading accept the responsibility for Candidate Signature:	Demonstrates correctly calibrating/bump checking the meter Demonstrates the correctly to erase stored data Demonstrates correctly hold the meter, and the correct settings Demonstrates correctly extracting stored data from the meter to paper printout and electronic storage. Demonstrates correctly for removing stored data for the next user.	Date:		

JPM Form (Preparation Date: Rev0 07/2004)